Rattle Noise from Automatic Transmission Control Cable Assembly in Reverse

Service Category Drivetrain

Section Automatic Transmission/Transaxle **Market** USA

Toyota Supports ASE Certification

Applicability

YEAR(S)	MODEL(S)	ADDITIONAL INFORMATION
2007 – 2009	Yaris	Transmission(s): 4AT

TSB SUPERSESSION NOTICE

The information contained in this TSB supersedes TSB No. TC005-07.

- **Applicability has been updated to include 2008 – 2009 model year Yaris vehicles.**
- **The Applicable Warranty has been updated in the Warranty Information section.**

TSB No. TC005-07 is Obsolete and any printed versions should be discarded. Be sure to review the entire content of this service bulletin before proceeding.

Introduction

Some 2007 – 2009 model year Yaris vehicles may exhibit a rattle noise from the engine compartment with engine speed above idle and the automatic transmission shift lever position in reverse. Follow the repair procedure below to address this condition.

Parts Information

PREVIOUS PART NUMBER	CURRENT PART NUMBER	PART NAME	QTY
90464-00748	Same	Clamp	1

Warranty Information

OP CODE	DESCRIPTION	TIME	OFP	T1	T2
TC5007	Secure Clamp for Transmission Control Cable Assembly	0.2	33820-5248#	91	57

APPLICABLE WARRANTY

- **This repair is covered under the Toyota Comprehensive Warranty. This warranty is in effect for 36 months or 36,000 miles, whichever occurs first, from the vehicle's in-service date.**
- **Warranty application is limited to occurrence of the specified condition described in this bulletin.**


© 2009 Toyota Motor Sales, USA

Rattle Noise from Automatic Transmission Control Cable Assembly in Reverse

Repair Procedure

1. Raise the vehicle and locate the No. 2 transmission control cable support to the left of the center exhaust pipe flange.
2. Using the plastic clamp, secure the automatic transmission control cable assembly to the No. 2 transmission control cable support. Refer to Figure 1 for the location.

Figure 1.

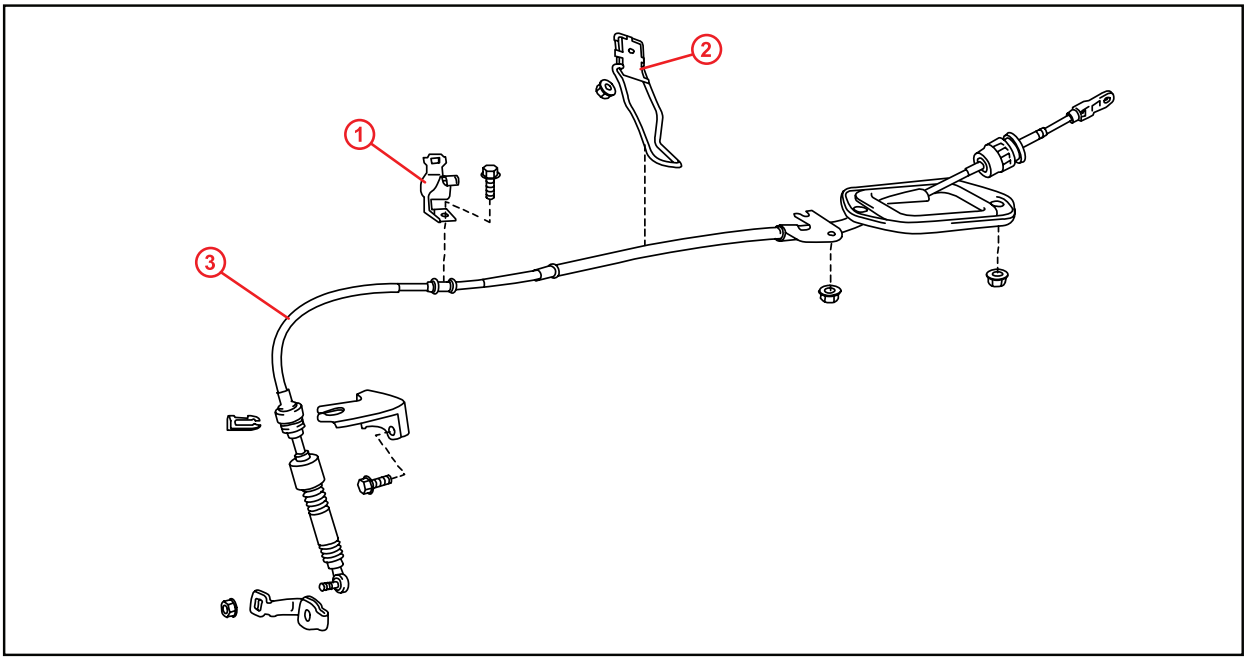

1	No. 1 Transmission Control Cable Support
2	No. 2 Transmission Control Cable Support
3	Automatic Transmission Control Cable Assembly

3. Confirm the repair.

© 2009 Toyota Motor Sales, USA